


# Temp. & RH% Datalogger

## Large display Temp. + RH% datalogger



- ▲ WALL MOUNTABLE SUPER LARGE DISPLAY FOR EASY READING AND SAVE SPACE
- ▲ AIR TEMP., DEW POINT TEMP.& RH% DISPLAY
- ▲ TRIPOD MOUNTABLE RECEPTACLE FOR LONG TIME USE
- ▲ DETACHABLE STANDERS TO TRANSFORM AS DESKTOP
- ▲ RECORDING TEMP. & HUMIDITY FOR QUALITY CONTROL
- ▲ BUTTON AND PC PROGRAMING ARE BOTH AVAILABLE
- ▲ SEVERAL METHODS TO START RECORDING: SCHEDULE / IMMEDIATELY START/KEY START/REPEAT
- ▲ RECORDING FUNCTION MUST BE POWERED BY ADAPTOR
- ▲ MONITORING MODE IS POWERED BY
  - BATTERY OR DC ADAPTOR(8808)
  - ADAPTOR (8809)
- ▲ BUILT IN USB INTERFACE FOR PROGRAM & DOWN LOAD
- ▲ LED FLASH& AUDIBLE WARNING WHILE EXCEEDING THRESHOLD
- ▲ UP TO 16000 POINTS MEMORIES
- ▲ TEMPERATURE UNITS SWITCHABLE
- ▲ SALT BOTTLE SELF-CALIBRATION AVAILABLE
- ▲ 8808 FEATURES: LCD DISPLAY/DATE & TIME DISPLAY
- ▲ 8809 FEATURES: RED LED DISPLAY

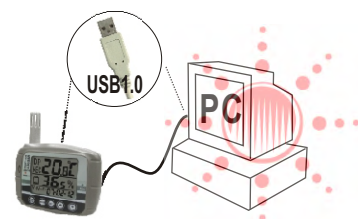

### Optional



CAL. SALT BOTTLE  
P/N:VZ0033AZ1(33%)  
P/N:VZ0075AZ1(75%)  
FOR 8808, 8809  
CALIBRATION USE

Model	8808	8809
Air temp. range	-20~70°C	
Air temp. resolution	0.1°C/°F	
Air temp. accuracy	+/-0.6°C (0~50°C), others +/-1.2°C	
Humidity. range	0%RH~100%RH	
Humidity resolution	0.1%RH	
Humidity accuracy	+/-3%RH (at 25°C, 10~90%RH, others +/-5%RH)	
Sampling points	16000	16000
Button to on/off	YES	YES
USB Interface	YES	YES
LCD size (mm)	51(H)x63(W)	
Storage temp.	-20~50°C	
Storage RH%	Humidity < 90%	
Dimension(mm)	120x93x42	120x93x42
Weight	~200g	~210g
Battery	AA bat.x4pcs or 9VDC adaptor	9VDC adaptor
Standard Package	Meter/Batteries(8808)or adaptor (8809) /Manual /Paper box/software CD/USB cable	
Optional Accessory	RH calibration salt kit	